FSN Ref: LUT-FSN-2023-001



Date: 04.JUL.2023

## Field Safety Notice accucury

For Attention of\*: LUTRONIC's Customer

Contact details of local representative (name, e-mail, telephone, address etc.)\*

This could be a distributor or local branch of the manufacturer. To be added at the appropriate stage in the different local languages

FSN Ref: LUT-FSN-2023-001



023-001 FSCA Ref: LUT-FSCA-2023-001

# Field Safety Notice (FSN) accucurv Thermal deformation of equipment

#### 1. Information on Affected Devices

#### Device Type(s)

accucurv is an Electromagnetic Stimulator delivering magnetic field energy with its applicators. The applicator generates a magneticfield through the electrical energy delivered from the system and delivers it to the treatment location. accucurv Electromagnetic stimulator is indicated for patients with musculoskeletal and neurological painful disorder to treat musculoskeletal disorders (e.g., osteoarthritis); and treat body pain. (musculoskeletal, traumatic).




- 1 2. Commercial name(s)
- . accucurv
- 1 3. Unique Device Identifier(s) (UDI-DI)
  - N/A
- 1 4. Primary clinical purpose of device(s)
  - accucurv system is intended to be used by a trained physician as treatment of the following: Gonarthrosis / Periarthritis / Coxarthrosis / Acute lumbar discopathy / Low back pain (e.g. vertebrogenic algic syndrome) / Sciatic syndrome / Post-traumatic nerve injuries of lower and upper limbs (grade of affection of the respective muscle nerve: 1 and 2)
- 1 5. Device Model/Catalogue/part number(s)
- . accucury(1101000200)
- 1 6. Software version
- GUI Software: Rev 1.03 / System Control Firmware: Rev 1.03 / Power Control Firmware: Rev 1.00
- 1 7. Affected serial or lot number range
- . MS122K001, MS123B006, MS122H006, MS122H007, MS122K002, MS122K003, MS122K004, MS122L005, MS122L006, MS122L007, MS122J001, MS122M002, MS123B001, MS123B004, MS122L001

FSN Ref: LUT-FSN-2023-001 FSCA Ref: LUT-FSCA-2023-001

	2 Reason for Field Safety Corrective Action (FSCA)				
2	Description of the product problem				
	The connection between the applicator and body may become loose due to external vibration,				
	shock or other factors. This loosening may cause heat generation.				
2	Hazard giving rise to the FSCA				
	The degree of heat may vary depending on the level of contact instability of the connector. This				
	instability could potentially lead to a rapid rise in temperature, causing a melt to the plastic cover.				
2	This may cause malfunction of the device or component failure.  3. Probability of problem arising				
_	Rare occurrence				
2	Predicted risk to patient/users				
	If a problem were to occur, it is unlikely that patient injury would occur because the user would				
	immediately recognize the abnormality. Also, if users are careful in their use, they should not				
	encounter any problems.				
2	<ol><li>Further information to help characterise the problem</li></ol>				
	If an abnormality is found in the applicator connection, stop using it and contact the manufacturer				
	immediately.				
2	Other information relevant to FSCA				
	We plan to upgrade and add additional parts to the lever, which will secure the junctions to be				
	appropriately placed, to prevent the loosening of connectors in all events and outside factors				

FSN Ref: LUT-FSN-2023-001 FSCA Ref: LUT-FSCA-2023-001

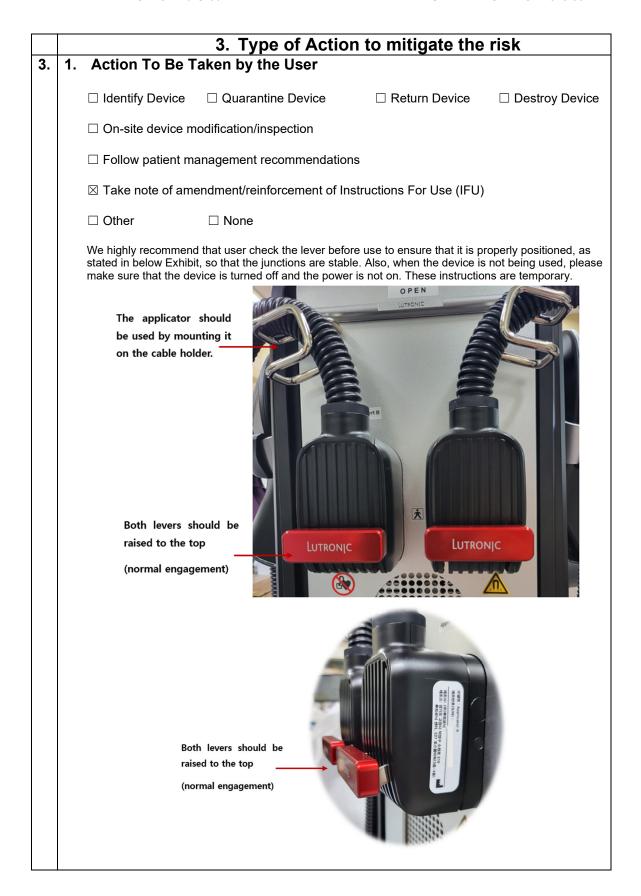

FSN Ref: LUT-FSN-2023-001 FSCA Ref: LUT-FSCA-2023-001

3.	2. Is customer Reply Required?		Yes		
	(If y	(If yes, form attached specifying deadline for return)			
3.	3. Action Being Taken by the Manufacturer				
		☐ Product Removal		ection	
		☐ Software upgrade	☐ IFU or labelling change		
		☐ Other	□ None		
		Thus, we plan to upgrade and add additional parts to the lever, which will secure the junctions to be			
		appropriately placed, to prevent the loosening of connectors in all events and outside factors			
3		By when should the	If user pay attention, it's not urge		
		action be completed?	be completed by December 31,	2023.	

FSN Ref: LUT-FSN-2023-001 FSCA Ref: LUT-FSCA-2023-001

	4. General Information		
4.	1. FSN Type	New	
4.	2. Further advice or information already expected in follow-up FSN?	No	
4.	3. Manufacturer information		
	(For contact details of local representative refer to page 1 of this FSN)		
	<ul> <li>a. Company Name</li> </ul>	Lutronic Corporation	
	b. Address	219 Sowon-ro, Deogyang-gu, Goyang-si,	
		Gyeonggi-do, Republic of Korea (10534)	
	<ul><li>c. Website address</li></ul>	https://www.lutronic-europe.com/	
4.	4. The Competent (Regulatory) Authority of your country has been informed about this communication to customers.		
4.	5. Name/Signature	JAEHOON RYU	

### **Transmission of this Field Safety Notice**

This notice needs to be passed on all those who need to be aware within your organisation or to any organisation where the potentially affected devices have been transferred. (As appropriate)

Please transfer this notice to other organisations on which this action has an impact. (As appropriate)

Please maintain awareness on this notice and resulting action for an appropriate period to ensure effectiveness of the corrective action.

Please report all device-related incidents to the manufacturer, distributor or local representative, and the national Competent Authority if appropriate, as this provides important feedback.